


# FortiSwitch Devices Managed by FortiOS Release Notes

FortiLink 7.0.10

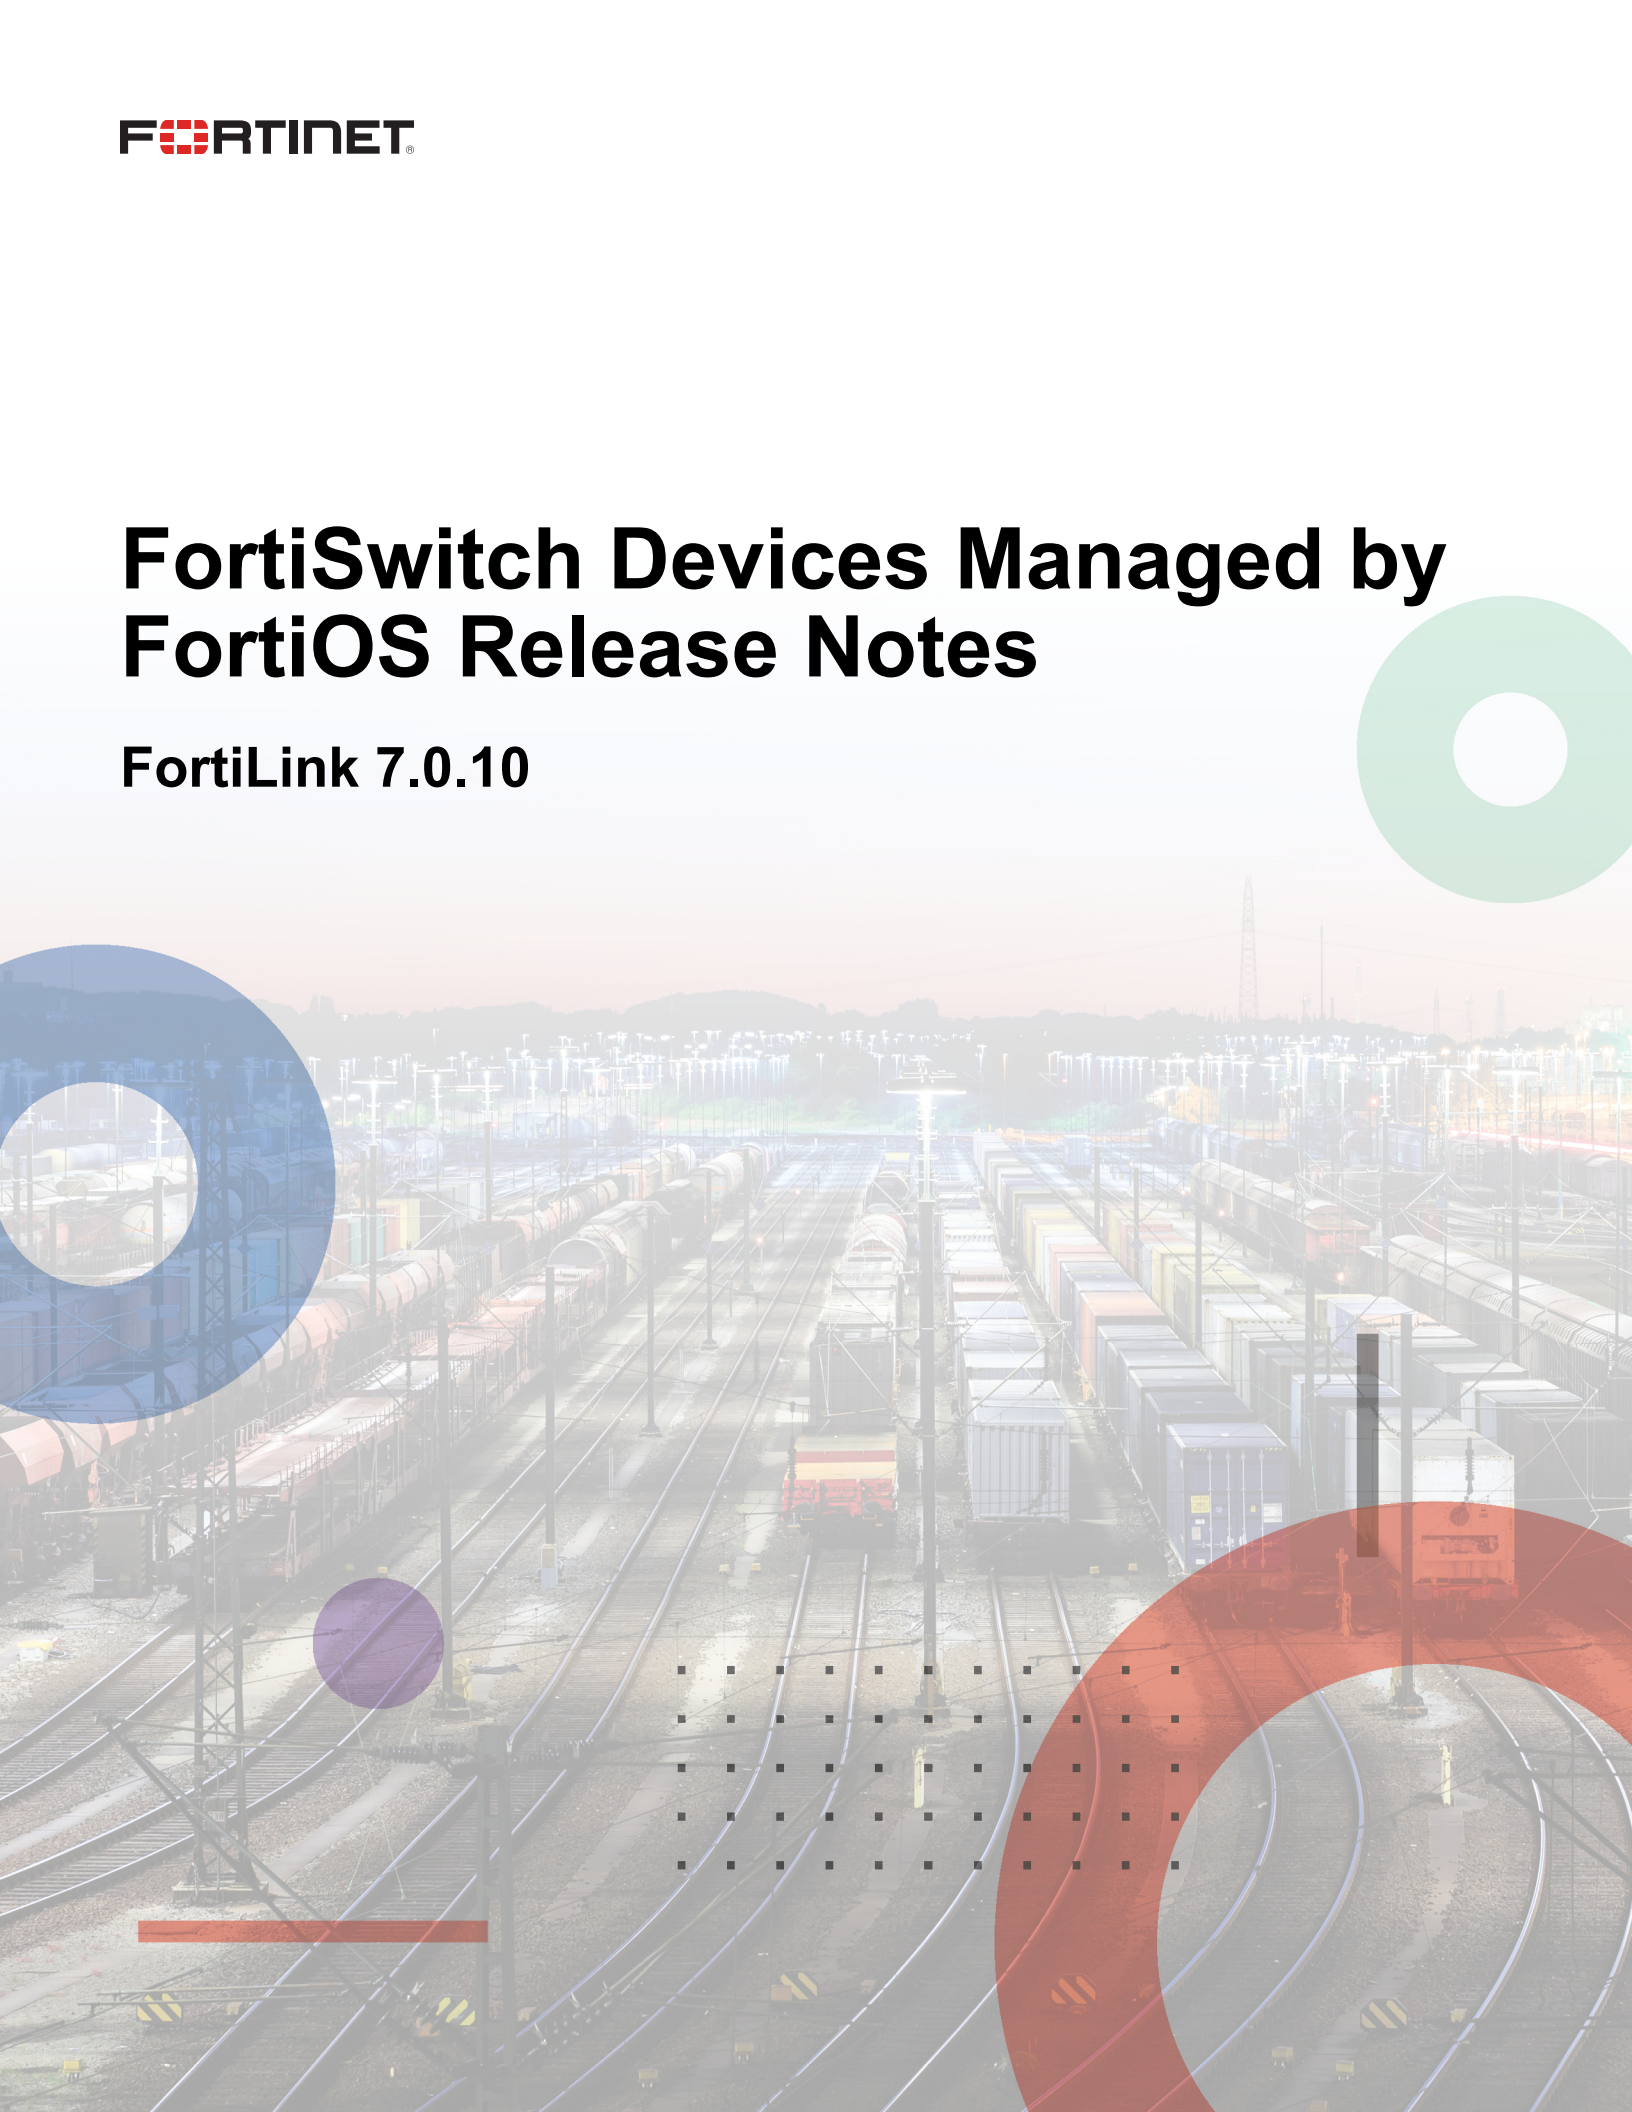

**FORTINET DOCUMENT LIBRARY**

<https://docs.fortinet.com>

**FORTINET VIDEO GUIDE**

<https://video.fortinet.com>

**FORTINET BLOG**

<https://blog.fortinet.com>

**CUSTOMER SERVICE & SUPPORT**

<https://support.fortinet.com>

**FORTINET TRAINING & CERTIFICATION PROGRAM**

<https://www.fortinet.com/support-and-training/training.html>

**NSE INSTITUTE**

<https://training.fortinet.com>

**FORTIGUARD CENTER**

<https://www.fortiguard.com>

**END USER LICENSE AGREEMENT**

<https://www.fortinet.com/doc/legal/EULA.pdf>

**FEEDBACK**

Email: [techdoc@fortinet.com](mailto:techdoc@fortinet.com)



February 23, 2023

FortiLink 7.0.10 FortiSwitch Devices Managed by FortiOS Release Notes

11-7010-872530-20230223

# TABLE OF CONTENTS

<b>Change log</b>	<b>4</b>
<b>Introduction</b>	<b>5</b>
What's new in FortiOS 7.0.10	6
<b>Special notices</b>	<b>7</b>
Support of FortiLink features	7
Downgrading FortiSwitchOS 7.0.0 and later to versions earlier than 6.2.6 or 6.4.4 is not supported	7
Downgrading FortiSwitchOS 7.0.0 and later requires converting the admin password first	7
NAC policies not maintained or converted when upgrading to 7.0.0	8
<b>Upgrade information</b>	<b>9</b>
<b>Product integration and support</b>	<b>10</b>
FortiSwitchOS 7.0.6 support	10
<b>Resolved issues</b>	<b>11</b>
<b>Known issues</b>	<b>12</b>

# Change log

Date	Change Description
February 23, 2023	Initial document release for FortiOS 7.0.10

# Introduction

This document provides the following information for FortiSwitchOS 7.0.6 devices managed by FortiOS 7.0.10 build 0450:

- [Special notices on page 7](#)
- [Upgrade information on page 9](#)
- [Product integration and support on page 10](#)
- [Resolved issues on page 11](#)
- [Known issues on page 12](#)

See the [Fortinet Document Library](#) for FortiLink documentation.

Refer to the [FortiLink Compatibility matrix](#) to find which FortiSwitchOS versions support which FortiOS versions.

**NOTE:** FortiLink is not supported in transparent mode.

The maximum number of supported FortiSwitch units depends on the FortiGate model:

FortiGate Model Range	Number of FortiSwitch Units Supported
FortiGate 40F, FortiGate-VM01	8
FortiGate 60F, 6xE, 80F, 8xE, 90E, 91E	16
FortiGate 100D, FortiGate-VM02	24
FortiGate 100E, 100EF, 100F, 101E, 140E, 140E-POE	32
FortiGate 200E, 201E	64
FortiGate 300D to 500D	48
FortiGate 300E to 500E	72
FortiGate 600D to 900D and FortiGate-VM04	64
FortiGate 600E to 900E	96
FortiGate 1000D to 15xxD	128
FortiGate 1100E to 26xxF	196
FortiGate-3xxx and up and FortiGate-VM08 and up	300



New models (NPI releases) might not support FortiLink. Contact [Customer Service & Support](#) to check support for FortiLink.

## What's new in FortiOS 7.0.10

This release is a patch release only. No new managed FortiSwitch features have been added in FortiOS 7.0.10.

# Special notices

## Support of FortiLink features

Refer to the [FortiSwitchOS feature matrix](#) for details about the FortiLink features supported by each FortiSwitchOS model.

## Downgrading FortiSwitchOS 7.0.0 and later to versions earlier than 6.2.6 or 6.4.4 is not supported

Downgrading FortiSwitchOS 7.0.0 and later to FortiSwitchOS 6.2.6 and later 6.2 versions is supported. Downgrading FortiSwitchOS 7.0.0 and later to FortiSwitchOS 6.4.4 and later 6.4 versions is supported. Downgrading FortiSwitchOS 7.0.0 and later to versions earlier than FortiSwitchOS 6.2.6 or 6.4.4 is not supported.

## Downgrading FortiSwitchOS 7.0.0 and later requires converting the admin password first

Because FortiSwitchOS 7.0.0 changed from SHA1 to SHA256 encryption for admin passwords, you need to convert the format of the admin password before downgrading from FortiSwitchOS 7.0.0 and later to an earlier FortiSwitchOS version.



If you do not convert the admin password before downgrading from FortiSwitchOS 7.0.0 and later, the admin password will not work after the switch reboots with the earlier FortiSwitchOS version.

---

The encrypted admin password in FortiSwitchOS 7.0.0 and higher starts with “SH2”, and the encrypted admin password for earlier FortiSwitchOS versions starts with “AK1”.

If you do not want to convert the format of the FortiSwitch admin password, you can use the FortiOS CLI to override the managed FortiSwitch admin password with the FortiGate admin password.

**To convert the format of the admin password in FortiSwitchOS 7.0.0 and later before downgrading to an earlier FortiSwitchOS version:**

1. Enter the following FortiSwitchOS CLI command to convert the admin password from SHA256 to SHA1 encryption:

```
execute system admin account-convert <admin_name>
```

2. Downgrade your firmware.

**To override the managed FortiSwitch admin password with the FortiGate admin password:**

```
config switch-controller switch profile
  edit <FortiSwitch_profile_name>
    set login-passwd-override enable
    set login-passwd <new_password>
  end
```

## NAC policies not maintained or converted when upgrading to 7.0.0

Existing NAC policies are not maintained or automatically converted into dynamic port policies after upgrading to FortiOS 7.0.0. They have to be reconfigured.



# Upgrade information

FortiSwitchOS 7.0.6 supports upgrading from FortiSwitchOS 3.5.0 and later.

To determine a compatible FortiOS version, check the [FortiLink Compatibility matrix](#).

Within the Security Fabric, the FortiSwitch upgrade is done after the FortiGate upgrade. Refer to the latest [FortiOS Release Notes](#) for the complete Security Fabric upgrade order.

# Product integration and support

## FortiSwitchOS 7.0.6 support

The following table lists FortiSwitchOS 7.0.6 product integration and support information.

<b>Web browser</b>	<ul style="list-style-type: none"><li>• Mozilla Firefox version 52</li><li>• Google Chrome version 56</li></ul> Other web browsers may function correctly, but are not supported by Fortinet.
<b>FortiOS (FortiLink Support)</b>	Refer to the <a href="#">FortiLink Compatibility matrix</a> to find which FortiSwitchOS versions support which FortiOS versions.

## Resolved issues

The following issues have been fixed in FortiOS 7.0.10. For inquiries about a particular bug, please contact [Customer Service & Support](#).

Bug ID	Description
840310	The FortiOS GUI shows just one of two ports used for the FortiLink aggregate interface.

# Known issues

The following known issues have been identified with FortiOS 7.0.10. For inquiries about a particular bug or to report a bug, please contact [Fortinet Customer Service & Support](#).

Bug ID	Description
298348, 298994	Enabling the <code>hw-switch-ether-filter</code> command on the FG-92D model (the default setting) causes FortiSwitch devices to not be discovered.
520954	When a “FortiLink mode over a layer-3 network” topology has been configured, the FortiGate GUI does not always display the complete network.
527695	<p>Starting in FortiOS 6.4.0, VLAN optimization is enabled by default (<code>set vlan-optimization enable</code> under <code>config switch-controller global</code>). On a network running FortiSwitchOS earlier than 6.0.0, this change results in a synchronization error, but the network still functions normally. If you have FortiSwitchOS 6.0.x, you can upgrade to remove the synchronization error or disable VLAN optimization.</p> <p>On a network with <code>set allowed-vlans-all enable</code> configured (under <code>config switch-controller vlan-policy</code>), the setting reverts to the default, which is disabled, when upgrading to FortiOS 6.4.0. If you want to maintain the <code>allowed-vlans-all</code> behavior, you can restore it after the upgrade.</p>
586801	NetBIOS stops working when proxy ARP is configured and the access VLAN is enabled because FortiGate units do not support NetBIOS proxy.
621785	<code>user.nac-policy[].switch-scope</code> might contain a data reference to <code>switch-controller.managed-switch</code> . When this reference is set by an admin, the admin needs to remove this reference before deleting the <code>managed-switch</code> .
813216	FortiLink randomly goes down after the <code>capwap-offload</code> setting is changed.
814674	When upgrading a FortiAP or FortiSwitch unit that is connected to a downstream FortiGate device, a “Failed to retrieve upgrade progress” message appears.
818116	When the FortiSwitch port status is changed in FortiOS, the configuration is not applied on the managed FortiSwitch unit.
853414	After upgrading from 7.0.5 to 7.0.7, the <i>Policy</i> and <i>Dashboard</i> widgets do not load when the FortiGate device manages a FortiSwitch unit with tenant ports.



[www.fortinet.com](http://www.fortinet.com)

Copyright© 2022 Fortinet, Inc. All rights reserved. Fortinet®, FortiGate®, FortiCare® and FortiGuard®, and certain other marks are registered trademarks of Fortinet, Inc., and other Fortinet names herein may also be registered and/or common law trademarks of Fortinet. All other product or company names may be trademarks of their respective owners. Performance and other metrics contained herein were attained in internal lab tests under ideal conditions, and actual performance and other results may vary. Network variables, different network environments and other conditions may affect performance results. Nothing herein represents any binding commitment by Fortinet, and Fortinet disclaims all warranties, whether express or implied, except to the extent Fortinet enters a binding written contract, signed by Fortinet's General Counsel, with a purchaser that expressly warrants that the identified product will perform according to certain expressly-identified performance metrics and, in such event, only the specific performance metrics expressly identified in such binding written contract shall be binding on Fortinet. For absolute clarity, any such warranty will be limited to performance in the same ideal conditions as in Fortinet's internal lab tests. Fortinet disclaims in full any covenants, representations, and guarantees pursuant hereto, whether express or implied. Fortinet reserves the right to change, modify, transfer, or otherwise revise this publication without notice, and the most current version of the publication shall be applicable.